

DENNEY
AEROCRAFT
COMPANY

December 24, 1991

SERVICE BULLETIN # 12

SUBJECT: Rotax 912 Throttle Cable

TO: Kitfox '912' Owners

FROM: Denney Aircraft Company

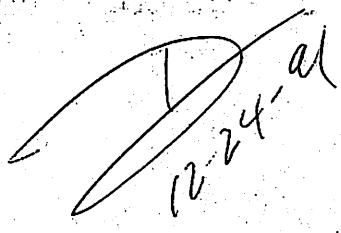
Denney Aircraft Company has had two incidents where the 912 Engine Throttle Cable in part 46007 or 46009 has broken after several hundred hours of operation. These solid-wire cables are apparently work-hardening from bending during usage and vibration causing them to fracture.

We recommend that these solid-wire style cables be replaced with a more flexible 1/16" (7x7) stainless steel braided cable, which is enclosed. It is necessary when using this cable that the springs on the throttle arms be installed and that they provide a positive pull to the wide-open position.

If you need assistance in any way, please call customer service, before returning any items to Denney Aircraft Co. Please obtain a Return Goods Authorization (RMA) number from customer service.

C.C 12-24-91

D.M.

 12-24-91

[Faint, mostly illegible text from a document, possibly a letter or report, covering the majority of the page.]